

- Improved stability and lower calibration costs
- Conduct loop testing of instrumentation systems (4-20 mA)
- Validate thermostatic devices and distributors
- Use as a calibrator and low-power generator for production facilities maintenance and electronic device evaluation





The HIOKI DC SIGNAL SOURCE SS7012 can be used not only for instrumentation system (4-20 mA) maintenance, but also for maintaining and servicing thermostatic devices, distributors, and industrial meters, as well as for evaluating electronic circuits and devices, and for production facility maintenance.

The signal source also supplies thermoelectromotive force corresponding to eight types of thermocouples. Furthermore, this compact DC signal source simultaneously sources and measures signals.

Use as A Hand-Held Field Calibrator for Loop Testing of Instrumentation Systems, and for Production Facility Maintenance

■ SS7012 Features

- Simultaneously sources up to ±25 V and ±25 mA while measuring up to ±28 V and ±28 mA (DC)
- Eight thermoelectromotive force sourcing (TC) modes (K, E, J, T, R, S, B, and N)
- TEMP measurement from -25 to 80°C
- Improved stability and lower calibration costs
- Control from a PC via USB connection

Example applications

- Instrumentation system loop testing (4-20 mA)
- · Validate thermostatic devices and distributors
- Use as a calibrator and low-power generator for production facilities maintenance and electronic device evaluation
- · Use as an electronic load (max. 25 mA DC)

Loop test (two-wire transmitter sensor)


Verifies proper sensor output (two-wire transmitter sensors). The SS7012 applies distributor power to the sensor as a constant-voltage (CV) output, and monitors current output from the sensor.

CV) output, and monitors current output from the sensor. larit

Two-Wire Transmitter 4-20 mA Sensor S

Thermometer calibration (TC, CV, and CC source)

Substitute the output of sensors such as TC (thermocouple) voltage, current and resistance with TC, CV, CC and Rs (100 Ω) test signals from the SS7012.

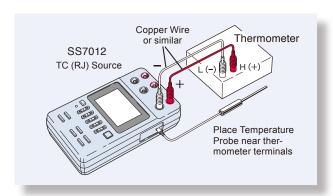


Temperature measurement

Use the optional 9184 Temperature Probe to measure temperatures from -25 to 80°C. As well as measuring ambient temperature, you can calibrate thermoelectric thermometers with reference junction compensation TC (RJ).


Loop test (distributor)

Test distributor operation. Apply the default current from the SS7012 as a substitute for sensor current output. Set SS7012 polarity to negative (to operate as a sink).

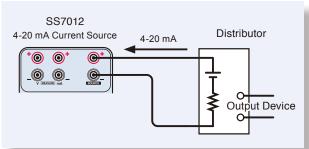

Store up to 20 steps in memory

Up to 20 levels can be stored for each source function, which can be recalled manually or in sequence automatically (auto scan). Use this function for meter checking, repetitive adjustments, and linearity testing.

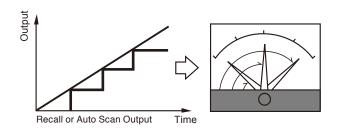

Portable, precise and stable


Despite the small size and light weight, the high precision and stability of $\pm 0.03\%$ for CV and CC sourcing, and $\pm 0.05\% \pm 0.5^{\circ}\text{C}^{*}$ for TC (0°C) sourcing, have one-year guaranteed accuracy. The compact hand-held design is convenient for travel, field calibration, and servicing applications.

^{*} For TC (0°C) sourcing of K, E, J, and T thermoelectromotive force .

Use as A Signal Source for Production Facility Maintenance, plus Electronic Device Testing and Evaluation.

Simultaneous voltage and current sourcing and display

Source up to ± 25.000 V and ± 25.000 mA while measuring up to ± 28.000 V and ± 28.000 mA. Isolated source and measurement circuits can increase operating efficiency for applications such as simultaneous input and output testing of transducers using a single instrument.

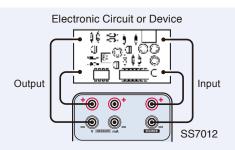




Small source applications

Use as a portable signal source for electronic device testing and evaluation. Full external control is available via the USB interface.*

* Only for communicating with a PC. Accessing USB memory is not supported.

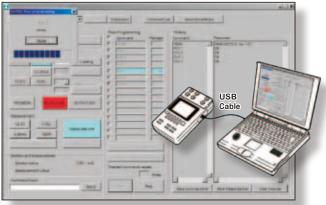

SS7012 Sample PC Application Screen

The SS7012 PC application is available at no cost from the HIOKI website.

Easy key operations

Intuitive operation is ensured by an up/down key for each setting digit, allowing quick output setup.

Source display

- · Bar indicates selected function
- Display of thermocouple setting for TC function
- · Set level and on/off output state

Measurement display

- Bar indicates selected function
- · Measured value or output value monitor
- Display of address and interval for memory setting and output

Operation keys

[SOURCE FUNCTION]

Source function selection key
[TC TYPE] Emulated thermocouple type selection key

[MEMORY] Memory source setting key [SET] Source level setting keys (for each digit) [+/-] Source polarity selection key [OUTPUT] Source output on/off key [MEASURE FUNCTION]

Measurement function selection key
[0 ADJ] Measurement zero adjustment key
[MONITOR] Measurement/Monitor value
selection key

■ SS7012 Specifications

(Accuracy quaranteed for 1 year, Post-adjustment accuracy quaranteed for 1 year)

(Accuracy guaranteed for 1 year, Post-adjustment accuracy guaranteed for 1 year)					
		Sourcing & Measurement Range	Resolution	Accuracy	Remarks
	Sourcing	Constant Voltage (CV) 2.5 V: 0 to ± 2.5000 V 2.5 V: 0 to ± 25.000 V	100 μV 1 mV	$\pm 0.03\%$ of setting $\pm 300~\mu V$ $\pm 0.03\%$ of setting $\pm 3~mV$	(Sink/Source) ±25 mA ±25 mA
		Constant Current (CC) 25mA: 0 to ±25.000 mA	1 μΑ	$\pm 0.03\%$ of setting $\pm 3 \mu A$	(Sink/Source) Approx. ±25 V
		Thermoelectromotive Force TC (0°C) K: -174.0 to 1372.0 °C E: -220.0 to 839.0 °C J: -208.0 to 1108.0 °C T: -169.0 to 400.0 °C R: -50 to 100 °C 101 to 1768 °C S: -50 to 100 °C 101 to 1768 °C B: 300 to 600 °C 601 to 1820 °C N: -113.0 to 1300.0 °C Thermoelectromotive Forc Thermocouple types, sour	rce range	±0.05% of setting ±0.5 °C ±0.05% of setting ±0.5 °C ±0.05% of setting ±0.5 °C ±0.05% of setting ±0.5 °C ±0.05% of setting ±1.5 °C ±0.05% of setting ±1.5 °C ±0.05% of setting ±1.0 °C ±0.05% of setting ±1.0 °C ±0.05% of setting ±1.5 °C ±0.05% of setting ±1.5 °C ±0.05% of setting ±0.5 °C Add the following to TC (0°C) accuracy	Output Resistance 5Ω or less IEC 584 Using TEMPERATURE
		TC (0°C) Memory Sourcing (RECAl One type for each functio	LL, SCAN) n: CV2.5,	±0.5 °C (@23 ±5 °C) ±1.0 °C (from 0 to 50 °C) ±2.0 °C (from -25 to 80 °C) Max. steps: 20 Interval: 1 to 99 s	PROBE 9184 Timing accuracy is not
		CV25, CC, TC (0°C and RJ)		1020	specified
		Standard Resistance (Rs) 100Ω		±0.2 Ω	±5 mΩ/°C
	Measurement	Voltage 2.5 V: 0 to ±2.8000 V 25 V: 0 to ±28.000 V	100 μV 1 mV	(after zero adjustment) $\pm 0.03\%$ of rdg. $\pm 300~\mu V$ $\pm 0.03\%$ of rdg. $\pm 3~mV$	Input Resistance Approx. 1 MΩ
		Current 25mA: 0 to ±28.000 mA	1 μΑ	(after zero adjustment) ±0.03% of rdg. ±3 μA	Input Resistance Approx. 30 Ω* or less
		Temperature -25 to 80 °C	0.1 °C	±0.5 °C (@23 ±5 °C) ±1.0 °C (from 0 to 50 °C) ±2.0 °C (from -25 to 80 °C)	Using TEMPERATURE PROBE 9184
	Monitor	Load current monitor	10 μΑ	$\pm 0.1\%$ of rdg. $\pm 20~\mu A$	0 to $\pm 28.00 \text{ mA}$
		Terminal voltage monitor	10 mV	±0.1% of rdg. ±20 mV	0 to ±28.00 V
		Reference contact temperature monitor	0.1 °C	±0.5 °C (@23 ±5 °C) ±1.0 °C (from 0 to 50 °C) ±2.0 °C (from -25 to 80 °C)	-25 to 80 °C

■ SS7012 General Specifications

Source output method: Bipolar sink/source A/D conversion method: Delta-Sigma

Temperature coefficients (sourcing):

 $\pm (0.005\% \text{ of setting} + 30 \,\mu\text{V}) \,/\,^{\circ}\text{C} \,(\text{CV:}\,2.5\text{V})$ $\pm (0.005\% \text{ of setting} + 0.2 \text{ mV}) / ^{\circ}\text{C} (CV: 25\text{V})$

 $\pm (0.005\% \text{ of setting} + 0.2 \,\mu\text{A}) \,/\,^{\circ}\text{C (CC: 25mA)}$

 $\pm (0.005\%$ of setting + 0.05 °C) / °C (TC(°C): K, E, J, T, and N) ±(0.005% of setting + 0.1 °C) / °C (TC(°C): R, S, and B)

 $\pm (0.01\% \text{ of setting} + 0.1 \text{ °C}) / \text{ °C} (TC(RJ): K, E, J, T, R, S, B, and N)$ $\pm 0.005 \Omega / ^{\circ}C (Rs)$

Temperature coefficients (measuring):

 $\pm (0.005\% \text{ rdg.} + 10 \,\mu\text{V}) / ^{\circ}\text{C} (\text{V: } 2.5\text{V})$

 $\pm (0.005\% \text{ rdg.} + 0.1 \text{ mV}) / ^{\circ}\text{C} (V: 25\text{V})$

 $\pm (0.005\% \text{ rdg.} + 0.1 \,\mu\text{A}) / ^{\circ}\text{C} (A: 25\text{mA})$

 ± 0.05 °C / °C (TEMP)

 $\pm (0.01\% \ rdg. + 1 \ \mu A) \, / \, ^{\circ} C \ (MONITOR \ CV: 2.5V \ and 25V)$

±(0.01% rdg. + 1 mV) / °C (MONITOR CC: 25mA)

±0.05 °C / °C (MONITOR TC (RJ))

Zero adjustment function: within ±100 counts (V, A, and measuring)

Display: Five-digit LCD ("28000")

Additional functions: Overflow display, USB communication, Monitor Operating temperature and humidity:

0 to 40 °C, 80% RH or less (non-condensing)

I/O protection: 50 mA, fused (sourcing and measuring)

Withstand voltage: 370 Vrms AC @1 mA for 15 seconds (source-tomeasurement terminals)

Power supply: Four LR6 alkaline batteries or HR6 Ni-MH batteries, or 9445-02 / -03 AC ADAPTER

Continuous operating time: (w/fully charged 2500-mAh Ni-MH batteries) Approx. 200 min (CC: 25mA range, sourcing 20 mA into 250 Ω load) Approx. 170 min (CV: 25V range, sourcing 25 V into 1 kΩ load) Approx. 280 min (V: 2.5V range, input terminals shorted)

Dimensions and mass: $104 \text{ mm} (4.09 \text{ in})W \times 180 \text{ mm} (7.09 \text{ in})H \times 58 \text{ mm}$ (2.28 in)D, 660 g (23.3 oz) (including LR6 × 4 batteries)

Accessories: One INPUT CORD 9168 set, one TEST LEAD 9170-10 set, one spare fused (F50 mA, 250 V "mizet" fuse), four LR6 alkaline batteries

^{*} Including approximately 15 Ω fuse resistance





Model: DC SIGNAL SOURCE SS7012

Model No. (Order Code)


SS7012

Note: Use of the AC Adapter and /or rechargeable batteries and dedicated charger is

Recommended combination examples

SS7012 (main unit) + AC ADAPTER 9445-02 / -03 + TEMPERATURE PROBE 9184 + CARRYING CASE 9782







PACKAGE SS9000

USB cable, USB driver

software included



9782



Includes compartment

for options, Hard type

AC ADAPTER 9445-02/03 100 to 240 V AC



CARRYING CASE 9380 For the SS7012, 7011 for storing the main body only, soft type



PROBE 9184 For reference contact compensation

Note: Company names and Product names appearing in this catalog are trademarks or registered trademarks of various companies HIOKI (Shanghai) SALES & TRADING CO., LTD. TEL +86-21-6391-0090/0092 FAX +86-21-6391-0360

HIOKI E.E. CORPORATION

HEADQUARTERS

81 Koizumi, Ueda, Nagano 386-1192 Japan TEL +81-268-28-0562 FAX +81-268-28-0568 http://www.hioki.com/ E-mail: os-com@hioki.co.jp

HIOKI USA CORPORATION

TEL +1-609-409-9109 FAX +1-609-409-9108 http://www.hiokiusa.com / E-mail: hioki@hiokiusa.com

http://www.hioki.cn / E-mail: info@hioki.com.cn HIOKI SINGAPORE PTE. LTD.

TEL +65-6634-7677 FAX +65-6634-7477 E-mail: info-sg@hioki.com.sg HIOKI KOREA CO., LTD.

TEL +82-2-2183-8847 FAX +82-2-2183-3360 E-mail: info-kr@hioki.co.jp

HIOKI EUROPE GmbH

TEL +49-6173-3234063 FAX +49-6173-3234064 E-mail: hioki@hioki.eu



DISTRIBUTED BY

ASITA srl Via Malpighi, 170 - 48018 Faenza (RA) Tel. +39 0546-620559 www.asita.com asita@asita.com Centro di Taratura ACCREDIA-LAT nr. 109